NO-D4 Nitric Oxide Sensor – Miniature Size

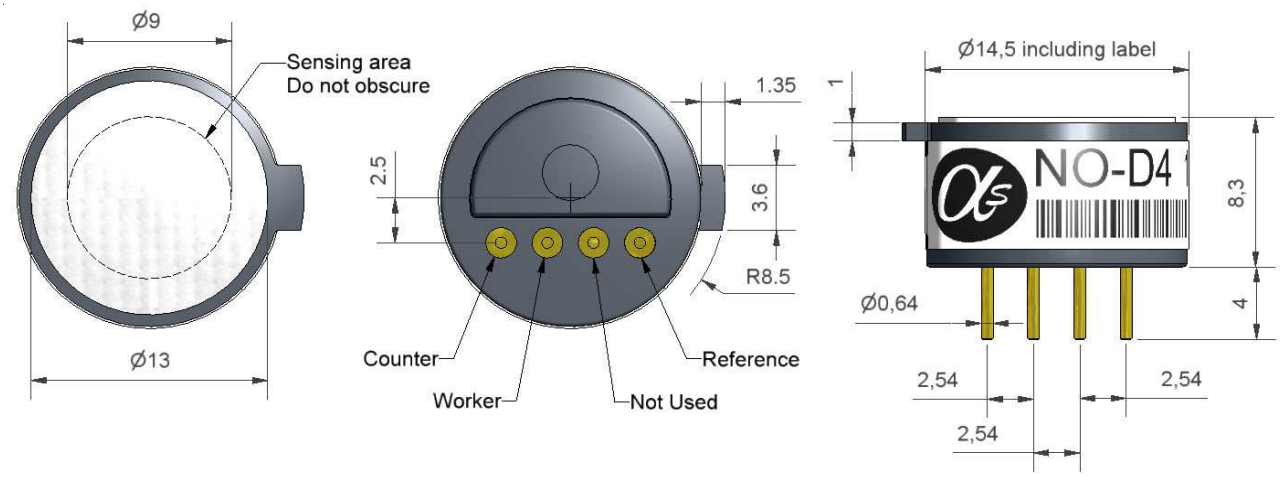

Top View **Bottom View** **Side View**

Dimensions are in millimetres (± 0.1 mm).

Performance	Sensitivity	nA/ppm in 40ppm NO		450 to 600
	Response time	t90 (s) from zero to 40ppm NO		< 15
	Zero current	ppm equivalent in zero air		< 0 to 1.5
	Resolution	RMS noise (ppm equivalent)		< 0.1
	Range	ppm limit of performance warranty		100
	Linearity	ppm error at full scale, linear at zero and 40ppm		< ± 1.5
	Overgas limit	NO maximum ppm for stable response to gas pulse		400
Lifetime	Zero drift	ppm equivalent change/year in lab air		< 0.4
	Sensitivity drift	% change/year in lab air, monthly test		< 5
	Operating life	months until 80% original signal (24-month warranted)		> 18
Environmental	Sensitivity @ -20°C	% (output @ -20°C/output @ 20°C) @ 40ppm NO		65 to 80
	Sensitivity @ 50°C	% (output @ 50°C/output @ 20°C) @ 40ppm NO		102 to 115
	Zero @ -20°C	ppm equivalent change from 20°C		< ± 0.5
	Zero @ 50°C	ppm equivalent change from 20°C		< 1.5 to 6
Cross-sensitivity	H_2S sensitivity	% measured gas @ 20ppm	H_2S	< 5
	NO_2 sensitivity	% measured gas @ 10ppm	NO_2	< 5
	Cl_2 sensitivity	% measured gas @ 10ppm	Cl_2	< 5
	SO_2 sensitivity	% measured gas @ 10ppm	SO_2	< 0.5
	CO sensitivity	% measured gas @ 400ppm	CO	< 0.1
	H_2 sensitivity	% measured gas @ 400ppm	H_2	< 0.1
	C_2H_4 sensitivity	% measured gas @ 1000ppm	C_2H_4	< 0.1
	NH_3 sensitivity	% measured gas @ 20ppm	NH_3	< 0.1
	CO_2 sensitivity	% measured gas @ 5%	CO_2	< 0.1
Key Specifications	Temperature range	°C		-20 to 50
	Pressure range	kPa		80 to 120
	Humidity range	% rh (see note below)		15 to 90
	Storage period	months @ 3 to 20°C (stored in sealed pot)		6
	Bias voltage	mV (working electrode above ground)		300mV
	Load resistor	Ω (for optimum performance)		10 to 47
	Weight	g		< 2

T: +44 (0)1376 556700 **E:** sensors.alphasense@ametek.com **W:** www.alphasense.com

For further information on the performance of this sensor, on other sensors in the range or any other subject, please contact Alphasense Ltd. or visit our website at "www.alphasense.com".

Figure 1 Sensitivity Temperature Dependence

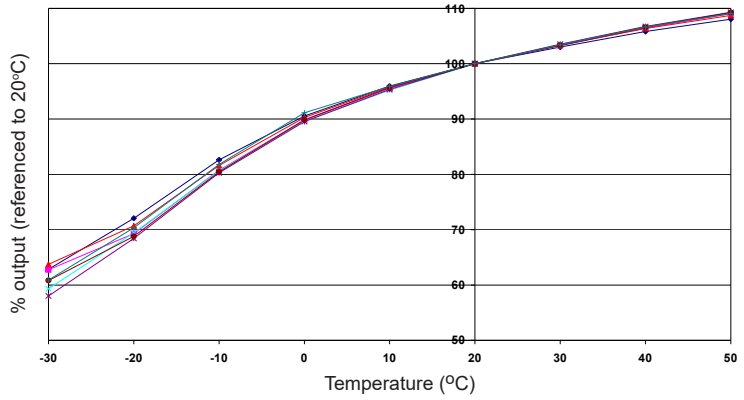

Figure 1 shows the variation in sensitivity caused by changes in temperature.

This data is taken from a typical batch of sensors.

Figure 2 Zero Temperature Dependence

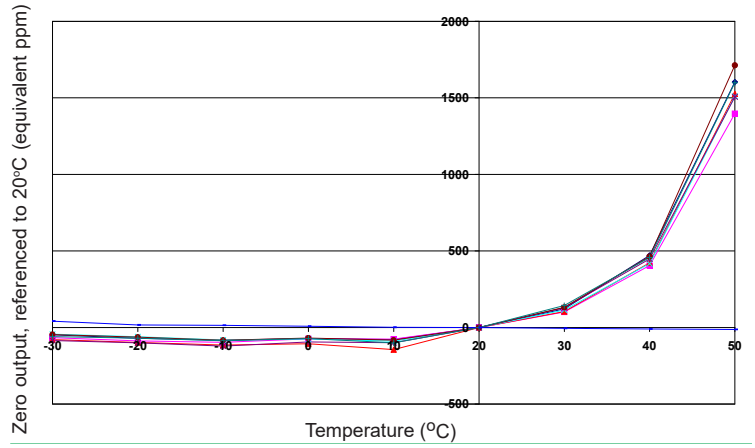

Figure 2 shows the variation in zero output caused by changes in temperature, expressed as ppm gas equivalent, referenced to zero at 20°C.

This data is taken from a typical batch of sensors.

Figure 3 Linearity to 100ppm NO

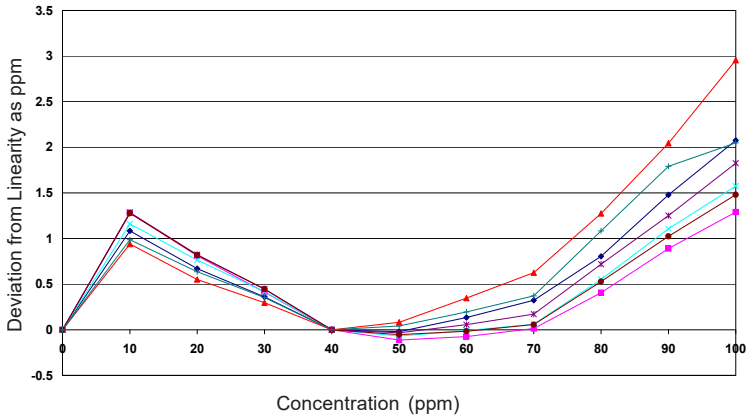

Sensors show nearly ideal linearity from 0 to 100ppm NO.